

ⓘ Refer to www.allen-heath.com for instructions on how to update the Avantis firmware and important notes about the update.

V1.02 February 2020

Maintenance Release

Improvements:

- Second PAFL bus added
- The Processing and Routing menu options now latch
- Mono main meter added
- Hardware Insert icons added to Bank view

Fixes:

- ID0207 AMM meters not working in Name Blocks
- ID0694 Input levels can be overwritten with Input to Matrix Send levels after a mix config change where Main is changed to None
- ID0989 The metering source point selection only affects meters on the Meters page, and not the channel strip meters
- ID1070 Pressing a SoftKey assigned to DCA Mix twice does not return the active Mix to Main
- ID1186 When sending Mains to a Stereo Matrix, the Mains send pan control affects the Mains balance and not the send pan
- ID1420 Some Direct Out options are missing on the Routing screen when the Options button is pressed
- ID1449 The Output Patchbay option in the Scene Safe system does not safe USB audio patching
- ID1490 Under certain circumstances the mixer could crash after a scene recall
- ID1493/1509/1528 The touchscreens could freeze or crash after a show recall
- ID1500 Touchscreens could freeze after a Mix Config change
- ID1550/1565/1586/1592 Fixes to channel strip rotary behaviour in sends mode
- ID1581 Touchscreens could restart after changes to the Input Stereos configuration

Several other minor fixes and improvements

Known issues:

- ID0893 In certain circumstances, the touchscreens can freeze on the ampersand screen when attempting to update firmware
- ID1031 A disconnected IP Controller can cause controls and metering to freeze every few seconds until the IP Controller is removed from the connection list
- ID1131 Creating a stereo input can take longer if multiple pages have been viewed

- ID1354 If an AB168/AR84 is connected to an AR2412 and becomes disconnected, the AR2412 will need to be reconnected to re-establish the AB168/AR84 connection
- ID1394 When moving a recording from internal storage to USB storage, the mixer can freeze for around 60 seconds

V1.01 January 2020

Maintenance Release

Fixes:

- ID1433 Occasionally the touchscreen can freeze when recalling a show with a different mix configuration to the current show
- ID1440 Internal error incorrectly shown when Name Block is configured to show IO and a strip where no IO may be assigned is selected
- ID1419 Internal error incorrectly shown when selecting mono channel after selecting stereo channel or vice versa

V1.00 December 2019

This is the first public release of Avantis firmware.