

**i** Refer to [www.allen-heath.com](http://www.allen-heath.com) for instructions on how to update the Avantis firmware and important notes about the update.

### V1.12 February 2022

#### Maintenance Release

#### Fixes:

- ID2544 Scenes can now be added to the end of cue lists when cue list is over 16 scenes.
- ID2579 Resolves issue whereby the connection or disconnection of Custom Control could cause the app to temporarily freeze.
- ID2574 Firmware update time and performance significantly improved when updating a DX-Hub and/or cascaded DX units.
- ID2045 Director now correctly displays dB level in Naming Area on level change.
- ID2218 Fixes issue where Sync Selected layer in Strip Assign may not work reliably in both directions.

#### Improvements:

- ID2489 Repositioned the Main Bus in the routing page for easier access.
- ID2409 Added dPack specific splash screen.
- ID2568 Updated fan controller to reduce unwanted modulation.
- ID2564 Support of latest DX32 hardware following component changes.
- ID2559 Support of latest DX012 hardware following component changes.
- ID2556 Support of latest DX164W hardware following component changes.
- ID2549 Support of latest AR & AB hardware following component changes.

#### Known Issues:

- ID0893 In certain circumstances, the touchscreens can freeze on the ampersand screen when attempting to update firmware.
- ID2318 GX4816 connected to gigaACE card during show recall can cause erroneous errors in log.
- ID1913 Talkback key in Director does not work correctly in non-latching mode.
- ID2306 MIDI Softkeys in Director fire both their 'on press' and 'on release' events on press.
- ID2303 Solo In Place softkeys in Director do not enable SIP.
- ID2300 DCA Spills do not work in Director when online.
- ID2182 LPF/HPF GUI not showing in bank view when off.
- ID2357 If running Director on a Microsoft Surface, touch and hold does not trigger right click menu on custom rotaries.

## Maintenance Release

**Fixes:**

- ID893 In certain circumstances, the touchscreens could freeze on the ampersand screen when attempting to update firmware.
- ID2434/2435/2412/2461 Several issues related to Dyn8 including erroneous 'Insert Bypassed' message, stereo mix channels losing Dyn8 assignment after reboot, and Listen function not working for Dyn8 bands.
- ID2364/2406/2458 In some circumstances the screen application would crash and restart when attempting to shut down.
- ID2334/992/1913 Several SoftKey issues including some assignments erroneously show as invalid, Tap Tempo not flashing accurately at every beat, and Talkback not working correctly in momentary (non-latching) mode.
- ID2429 The global Direct Out source would switch to Post Preamp after viewing the Routing screen.
- ID1647 Event Logs could cause the mixer to run out of memory after a prolonged period of use.
- ID2471 Locking the mixer would not lock all screens.
- ID1542 A stalled fan would only be reported if already stalled at boot up.
- ID2442 Delays for mix channels were not displayed correctly after a bus config change.
- ID2348 The static IP address was not greyed out when activating DHCP.
- ID2438 Follow Main Pan icons were incorrectly displayed for mono mixes.
- ID2414 Recalling a Show from the Director Show manager would sometimes fail.
- ID2074 Block strip assignment would sometimes not work correctly.
- ID2416 MIDI strips in Director would only send the default MIDI messages.
- ID2307 Some MIDI MMC controls would not work reliably at every press.
- ID2308 Overwriting a Template Show on a USB drive would cause errors.
- ID2303 Solo In Place softkeys in Director would not enable SIP.

*Several other minor fixes and improvements.*

**Known Issues**

- ID2318 GX4816 connected to gigaACE card during show recall can cause erroneous errors in log.
- ID2424 AES and Wordclock settings are not persistent after reboot and don't update correctly after a Show recall.
- ID2510 Recalling a V1.0x Show from the Director Show file manager can fail while running Director online.
- ID2306 MIDI Softkeys in Director send both their 'on press' and 'on release' events on press.
- ID2300 DCA Spills do not work in Director when online.
- ID2182 LPF/HPF GUI not showing in bank view when off.
- ID2357 If running Director on a Microsoft Surface, touch and hold does not trigger right click menu on custom rotaries.

**Feature Release****New Features**

- Support of Avantis Director (offline editor / online control software for Windows and Mac).
- Follow / Invert pan option for Stereo Auxes and Matrices.
- LCR+ Main bus mode with Divergence control.
- Support of MIDI over TCP/IP.
- Solo in Place.
- Several new routing and patching options:
  - Mixes and PAFL available as Input sources
  - Mixes can be patched to PAFL Ext In
  - Mixes and PAFL can be patched to Mix Ext In

**Additional New Features for dPack users**

- Optronik compressor.
- Hypabass subharmonic synth RackFX unit.
- Transient Controller RackFX unit.

**Improvements**

- Embedded Scene Recall now supports remote Avantis, dLive and AHM units.
- New Softkey functions.
- New De-Esser modes.
- USB Audio Playback shows Elapsed and Remaining time.
- Stereo Record options expanded to include Tie Lines, PAFL or FX Unit outputs.
- Improved meter performance.

**Fixes**

- ID1684 Unplugging cascaded DX unit connected to GX4816 could cause Preamp controls to disappear.
- ID1635 Fixes issue whereby in certain circumstances, recalling a Scene from a Cue List would not work.
- ID1630 Corrects GX4816 gain Insert behaviour. Return socket now correctly defaults to 0dB.
- ID1624 Directly patching RackFX output after change from Insert to Mix could cause a crash.
- ID1372 Various improvements to GUI responsiveness.
- ID1354 Cascaded devices connected to AR2412 now reconnect correctly after disconnecting and reconnecting dSnake.
- ID1238 Connecting sLink to gigaACE card immediately after a GX4816 could cause channels not to pass audio until Avantis is power cycled.
- ID623 Side chain sources now shown correctly in drop down menu.
- ID1926 Removes erroneous source point drop down for FX return.
- ID1683 Corrects Preamp GUI behaviour after hotplugging GX4816.

- ID1673 A Scene created with a DX unit connected now recalls correctly without the DX unit connected.
  - ID1667 De-Esser Dual Mono mode would always key from channel 1.
  - ID1563 Incorrect show was highlighted after show update.
  - ID1256 Matrix DCA membership indication could be incorrect in naming area after assignment.
  - ID1220 FX Return PEQ could recall during scene changes even when safe.
  - ID555 Utility page could be shown after show recall.
  - ID1977 FX Send name and colour could recall during scene changes even when safe.
  - ID1363 Scene update softkey now correctly opens scene update page.
  - ID1038 Adding large amounts of DCA gain (20db+) to outputs could cause audio level reduction.
  - ID507 Frozen strip indication could become unsynced from GUI after mix config change.
  - ID450 Blank space option missing from user meters.
  - ID1691 / ID1614 / ID1394 / ID1426 / ID1488 / ID1004 / ID935  
Various USB Play/Record system fixes.
  - ID1188 / ID1015 / ID910 / ID1349  
Various fixes to GUI behaviour on scene auto-increment.
- Several other minor fixes and improvements.*

**Known Issues**

- ID0893 In certain circumstances, the touchscreens can freeze on the ampersand screen when attempting to update firmware.
- ID2318 GX4816 connected to gigaACE card during show recall can cause erroneous errors in log.
- ID1913 Talkback key in Director does not work correctly in non-latching mode.
- ID2306 MIDI Softkeys in Director fire both their 'on press' and 'on release' events on press.
- ID2303 Solo In Place softkeys in Director do not enable SIP.
- ID2300 DCA Spills do not work in Director when online.
- ID2182 LPF/HPF GUI not showing in bank view when off.
- ID2357 If running Director on a Microsoft Surface, touch and hold does not trigger right click menu on custom rotaries.

**V1.03 April 2020**

Maintenance Release

**Fixes:**

- ID1619 DX expanders would not automatically update over SLink.
- ID1610 Improved management of internal fan speed.
- ID1607/1605 Fixes to USB playback system.
- ID1624 Repatching FX units in the I/O screen could sometimes crash the software.

- ID1630 Inserts over SLink would sometimes present the wrong return level.
  - ID1631/1629 Fixes to gain control on channel rotaries.
  - ID200/1553 Resolution of several Internal Errors in the Event Log.
- Several other minor fixes and improvements.*

**Known issues:**

- ID1635 In certain circumstances, recalling a Scene from a Cue List doesn't work.
- ID0893 In certain circumstances, the touchscreens can freeze on the ampersand screen when attempting to update firmware.
- ID1031 A disconnected IP Controller can cause controls and metering to freeze every few seconds until the IP Controller is removed from the connection list.
- ID1131 Creating a stereo input can take longer if multiple pages have been viewed.
- ID1354 If an AB168/AR84 is connected to an AR2412 and becomes disconnected, the AR2412 will need to be reconnected to re-establish the AB168/AR84 connection.
- ID1394 When moving a recording from internal storage to USB storage, the mixer can freeze for around 60 seconds.

**V1.02 February 2020**

Maintenance Release

**Improvements:**

- Second PAFL bus added.
- The Processing and Routing menu options now latch.
- Mono main meter added.
- Hardware Insert icons added to Bank view.

**Fixes:**

- ID0207 AMM meters not working in Name Blocks.
- ID0694 Input levels could be overwritten with Input to Matrix Send levels after a mix config change where Main is changed to None.
- ID0989 The metering source point selection only affected meters on the Meters page, and not the channel strip meters.
- ID1070 Pressing a SoftKey assigned to DCA Mix twice would not return the active Mix to Main.
- ID1186 When sending Mains to a Stereo Matrix, the Mains send pan control would affect the Mains balance and not the send pan.
- ID1420 Some Direct Out options were missing on the Routing screen when the Options button is pressed.
- ID1449 The Output Patchbay option in the Scene Safe system does not safe USB audio patching.
- ID1490 Under certain circumstances the mixer could crash after a scene recall.
- ID1493/1509/1528 The touchscreens could freeze or crash after a show recall.
- ID1500 Touchscreens could freeze after a Mix Config change.
- ID1550/1565/1586/1592 Fixes to channel strip rotary behaviour in sends mode.

ID1581 Touchscreens could restart after changes to the Input Stereos configuration.

*Several other minor fixes and improvements.*

## **V1.01 January 2020**

Maintenance Release

### **Fixes:**

- ID1433 Occasionally the touchscreen can freeze when recalling a show with a different mix configuration to the current show.
- ID1440 Internal error incorrectly shown when Name Block is configured to show IO and a strip where no IO may be assigned is selected.
- ID1419 Internal error incorrectly shown when selecting mono channel after selecting stereo channel or vice versa.

## **V1.00 December 2019**

This is the first public release of Avantis firmware.