


Aim: To remove fader panel to replace / service fader modules and the fader motor PSU circuit.

Tools: ☆ T15, T20, T30. ✚ PZ2 (demo units)

Requirements: 👤 An assistant will be required to lift the fader panel.


1. Remove screws:

- a. T15 screws from under armrest x5 112, x7 144 & 176
- b. T20 from side trim x2 left, x2 right
- c. T30 from side trim x2 left, x2 right

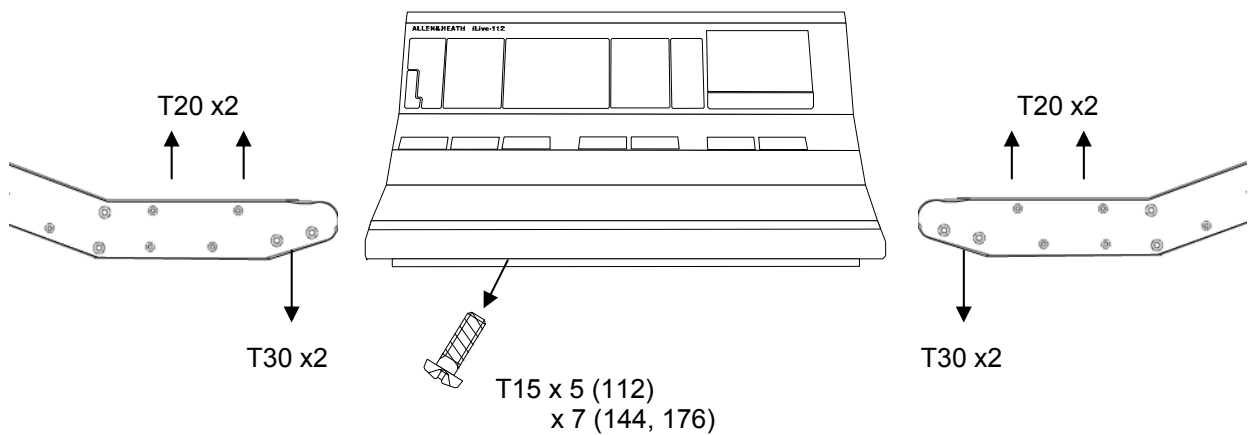


2.


- a. Pull the fader panel forward 5mm.
- b. Lift the fader panel vertically.
- c. Pull fader panel forward until the harnesses can be seen.

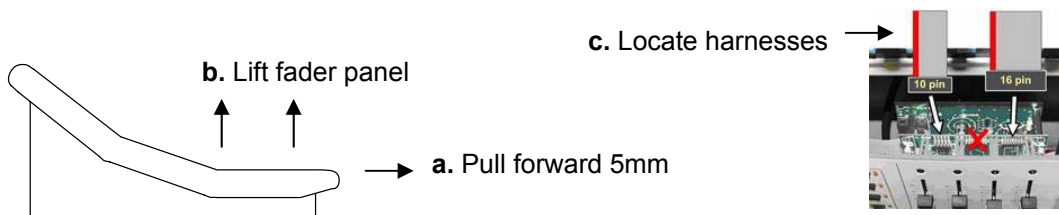

3. Disconnect harnesses x2

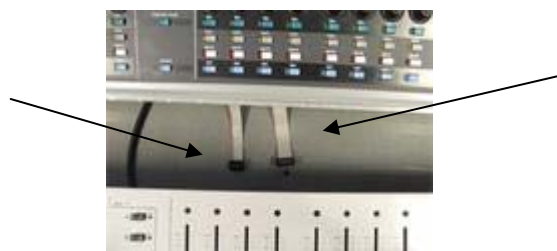


4. a) Cut cable tie
b) Disconnect DC cable
c) De- solder green ground wire.

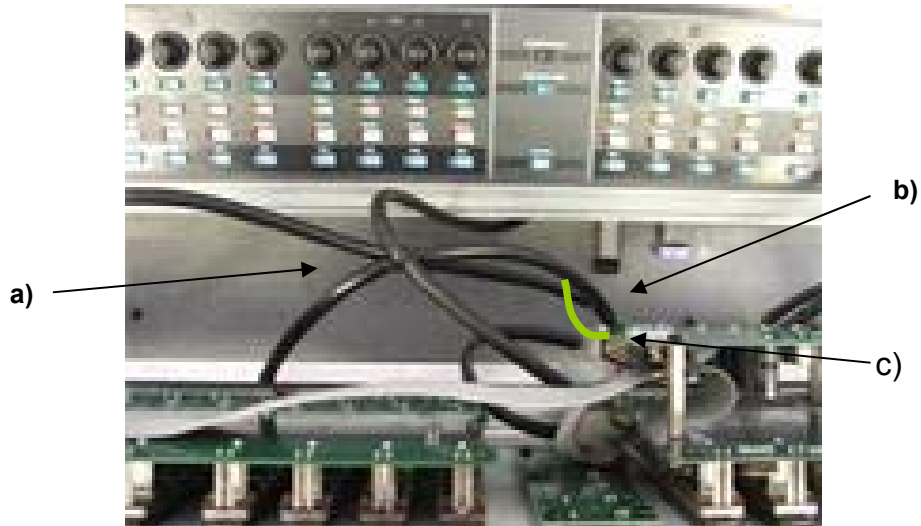

5. The fader panel can now be lifted away from the surface.

6. Position of harnesses for re-assembly

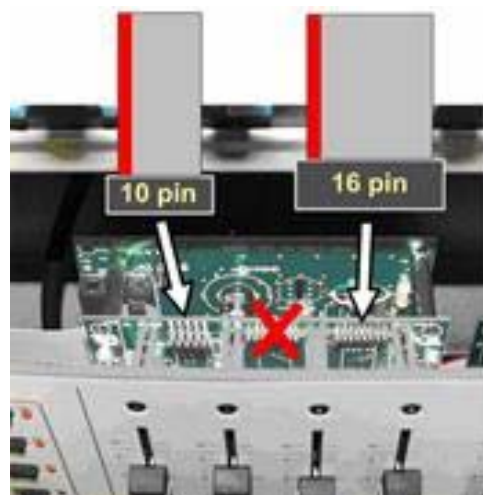

7. Before reassembly refit the cable tie as shown in 4 a.